Пример настройки шпинделя на Modbus RS485 на контроллере ET15

описание регистров для записи-чтения Modbus находится тут - plc_modbus_api

В примере описывается подключение инвертора Yaskawa v7.

Проверить, что отсутствует настройка расширителей IO портов на Modbus. При наличии удалить

Setup→Inputs/Outputs/Sensors→I/O Expand cards mapping

SYS PLC Log	Report Info Support Camera Config Image: Config Image: Config Image: Config Image: Config	SAVE CFG
CNC Settings	Manping device Device Id Source port	
 Inputs/Outputs/Sensors 	(Modbus) Delice part port	
Alarms	Modbus Input Holding Register and a 15 15 1 2 1	
X-Alarms	Modbus/Coll Coll Collary Annual State Stat	
Limits		
MPG through bipary inputs		
hand dirioden bindry inputs	0000000 800000015	
I/O Expand cards mapping	16 0 0 0 0 0 0 24 0 0 0 0 0 0 31	
ADC Mapping	32 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0 0	
Connections	48 0 0 0 0 0 0 56 0 0 0 0 0 0 63	
Motion	64 0 0 0 0 0 0 72 0 0 0 0 0 0 79	
- PLC	80 0 0 0 0 0 0 88 0 0 0 0 0 0 95	
Hardware PLC	96 0 0 0 0 0 0 104 0 0 0 0 0 0 0 111	
Hardware PLC Templates		
Software PLC: XML configs	128 0 0 0 0 0 0 136 0 0 0 0 0 0 143	
G-codes settings	144 0 0 0 0 0 0 152 0 0 0 0 0 0 159	
DXF Import settings	0.0000000 800000015	
Macro List		
Macro Wizard Brobing Wizard	32 0 0 0 0 0 0 0 0 0 0 0 0 0 0 47	
 Probing Wizard Preferences 		
Common		
Start/Stop		
Shape Library Settings		
Work Offsets		
Parking Coordinates		
 Technology 		
Plasma Cutting		
Litre antibarra Cara recursionitan	1	

Important

Important!
If the Modbus device is controlled directly from the PLC procedure,
"RS485/Modbus communication"
checkbox should be UNCHECKED in Settings > Config > Technology > Mill/Lathe
> Spindle
configuration dialog

SYS PLC Log Config	Info Support Camera Config	SAVE CFG
CNC Settings Axes/Motors Inputs/Outputs/Sensors Network Motion PLC G-codes settings	Spindle Speed, [rpm] (Min, Max, Step) 100 100 100 Spindle Overspeed, [%] (Min, Max, Step) 1 100 1 Encoder channel Not used 1 1 Encoder pulses per revolution 1 1 1 9 9 1 1 1	<u> </u>
DXF import settings Macro List • Macro Wizard • Probing Wizard • Preferences • Screen Work Offsets Parking Coordinates	Voltage offset, units 1 Voltage ratio, units 1 RS485/Modbus communication X Speed ratio (modbus) 1 RS485 speed 9600 Source from the second se	
 Technology Plasma Cutting Gas/Oxyfuel Cutcharts THC Mill/Lathe Spindle 	Connection 8 1 N 1 1 1 Inverter Address 7 2 1 2 1 2 1 1 Inverter Modbus address should be 16 or more. Addresses 015 reserved for Non-Modbus devices. Messages: Exceptions: Write registers	
Tools ATC Pots Lathe Multi Head Laser control Tangential Knife	WR/Operate Image: Send WR/Frequency Image: Send Read registers Send RD/Drive Status Image: Send	_
 Special Purpose Camera S axes RTCP Panel/Pendant Hardware Advanced 	RD/Fault Content Image: Reference RD/Frequency reference Image: Reference RD/Output frequency Image: Reference RD/Output current Image: Reference	<u>-</u>

Для Hardware PLC добавить файл с процедурами общения по Modbus

func-modbus.h

```
send_init_modbus()
{
 gvarset(60011,0);//set RTU
 gvarset(60012,9600);//set baud
 gvarset(60010,0x1e);//to Modbus Device # 0x1f
};
send_m3_modbus()
 gvarset(60019,0x31);//set Register Value
 gvarset(60030,0x1);//send value to Address
 timer=200; do{timer--;}while(timer>0);
 gvarset(60019,0x31);//set Register Value
 gvarset(60030,0x1);//send value to Address
};
send speed modbus()
 gvarset(60019,val);//set Register Value //SPEED
 gvarset(60030,0x02);//send value to Address
};
```

```
send_m5_modbus()
{
  gvarset(60019,0);//set Register Value
  gvarset(60030,0x02);//send value to Address
  gvarset(60019,0x0);//set Register Value //OFF
  gvarset(60030,0x1);//send value to Address
};
```

Инициализация порта Modbus

Инициализация порта Modbus должна выполняться один раз при запуске системы. Ее можно добавить в Software PLC системную процедуру HANDLER_INIT.plc

Адрес инвертора на шине Modbus установлен в значение 30 (0x1e) Скорость RS485 - 9600

__HANDLER_INIT.plc

```
send_init_modbus() //Определение процедуры
{
  gvarset(60011,0);//set RTU
  gvarset(60012,9600);//set baud
  gvarset(60010,0x1e);//to Modbus Device # 0x1e
};
main()
{
  send_init_modbus() //Вызов инициализации
  exit(99);
};
```

Регулировка скорости шпинделя

Регулировка скорости шпинделя может осуществляться из Software PLC "....SPN.plc" или из Hardware PLC "SPN.plc" При наличии в системе обоих файлов процедур, приоритет имеет Software PLC "....SPN.plc"

Регистр скорости в инверторе имеет адрес "0x02"

Пример Software PLC

```
_SPN.plc
```

```
send_speed_modbus()
{
  gvarset(60019,val); //set Register Value //SPEED
  gvarset(60030,0x02); //send value to Address
};
//set Spindle speed control via MODBUS
main()
{
  val=eparam*10;
  gvarset(7371,eparam); timer=2;do{timer--;}while(timer>0); //Spindle
State
  send_speed_modbus();
  exit(99); //normal exit
};
```

В зависимости от настроек инвертора по единицам задания скорости шпинделя, коэффициент "10" при задании переменной **val** необходимо изменить соответствующим образом.

При желании использовать Hardware PLC, текст процедуры "SPN.plc" будет полностью идентичным "__SPN.plc"

Включение шпинделя

Управляющий регистр инвертора имеет адрес "0x01"

Для включения шпинделя надо выставить "бит 0" (записать значение 1) в этот регистр

M03.plc

```
send_m3_modbus()
{
  gvarset(60019,0x1); //set Register Value (1)
  gvarset(60030,0x1); //send value to Address (1)
  timer=200; do{timer--;}while(timer>0);
  //repeat the command for any case
  gvarset(60019,0x1); //set Register Value (1)
  gvarset(60030,0x1); //send value to Address (1)
};
```

```
main()
{
  val=eparam*10;
  timer=0;
  proc=plc_proc_spindle;
  gvarset(7371,eparam); timer=30;do{timer--;}while (timer>0); //Spindle
  Speed Mirror register
  send_speed_modbus();
  send_m3_modbus();
  gvarset(7370,1); timer=30;do{timer--;}while (timer>0); //Spindle
  State
  //delay after spindle started
  timer=spindle_on_delay;
  do{timer--;}while (timer>0); //delay for Spindle reach given speed
  exit(99); //normal exit
};
```

Выключение шпинделя

Управляющий регистр инвертора имеет адрес "0x01"

Для выключения шпинделя надо записать 0 в регистр регистр

```
M05.plc
```

```
send_m5_modbus()
{
    //set speed 0
    gvarset(60019,0); //set Register Value (0)
    gvarset(60030,0x02); //send value to Address //The speed
    register(2)
    //off spindle
    gvarset(60019,0x0); //set Register Value //OFF (0)
    gvarset(60030,0x1); //send value to Address //The control register (1)
};
main()
{
```

```
send_m5_modbus();
proc=plc_proc_idle;
if (spindle_off_delay!=0)
{
   timer=spindle_off_delay;
   do { timer--; } while (timer>0);
};
gvarset(7370,0); timer=30;do{timer--;}while(timer>0); //Spindle
State
   exit(99); //normal exit
};
```

From: http://www.cnc42.com/ - myCNC Online Documentation

Permanent link: http://www.cnc42.com/mycnc/et15-rs485-modbus-rus

Last update: 2023/01/20 15:41