Rotary encoder connection and setup

There are 2 types of rotary encoders widely used in pendants and operator panels:

• Simple rotary encoder based on 2 switches. This type of encoders usually generates around 10-40 pulses per revolution (PPR) and used as fancy style "endless multi-turn potentiometer".



Industrial style MPG with 100ppr and line driver 5V output

Both types can be connected to myCNC controller and used the operator control panel.

EN11 rotary encoder connection

Encoders can be connected to the galvanic isolated binary inputs. 2 Inputs are used to connect each encoder.



Encoder should be set up in the **Config > Inputs/Outputs/Sensors > MPG through binary inputs** configuration dialog.

myCNC controllers support up to 4 software encoders defined through binary inputs.

ET7 controller slow encoders setup

The myCNC-ET7 control board has 2 encoders (Encoder #0, #1) reserved defined permanently. These encoders are supposed to be installed on the ET7-KEY keyboard panel and connected to the 20-pin X4 connector on ET7 control board. It's possible to use external encoders without the ET7-key panel board and to connect those directly to X4 pins 11,12,13,14 and 19. See the table below for more information on the ET7 X4 pinout table:

X4 connector to External 25-keys keyboard		
Pin#	Name	Comments
11	E#0	Binary input #16, En#0 A
12	E#1	Binary input #17, En#0 B
13	E#2	Binary input #18, En#1 A
14	E#3	Binary input #19, En#1 B
19	GND	



These pins are actually Binary inputs #16, #17, #18, #19 which are permanently configured as Encoder#0 and Encoder#1 in myCNC-ET7 controller firmware. This is the reason Slow Encoders #0, #1 configuration for ET7 controller in myCNC software is ignored and can be skipped. **However, Encoder #2, Encoder#3 can be attached to any or binary inputs and configured accordingly when using the ET7 board.**

For all other control boards (ET6, ET10 and ET15), the slow encoders configurations #0-3 are active and can be used by users.

Rotary encoders setup example is shown on a picture below

Last update: 2019/11/07 mycnc:rotary_encoder_connection_and_setup http://docs.pv-automation.com/mycnc/rotary_encoder_connection_and_setup?rev=1573134045 08:40

SYS PLC Log Config	Info Weight Camera Config Config X	SAVE CFG
CNC Settings	MPG/Encoder through binary inputs	
Axes/Motors Inputs/Outputs/Sensors	Input1 Input2 Slot Axis Dimension Encoder Resolution	
Alarms X-Alarms	#0 🔀 16 🔶 17 🔶 MPG wheel 🔻 General Purpose 👻 🛛 400 🚖	
Limits Triggers/Timers	#1 🕱 18 🔶 19 🔶 MPG wheel 🔻 General Purpose 👻 🛛 400 🜩	
MPG through binary inputs	#2 📝 0 🔶 1 🔶 MPG wheel 🝸 Pendant 👻 🛛 65536 🜩	
Jog through ADC inputs I/O Expand cards mapping	#3 📝 2 🚖 3 🚖 MPG wheel 🔻 General Purpose 🖌 🛛 400 🚖	
ADC Mapping	MPG/Encoder ET10 encoder inputs	
Network	Input# Slot Axis Dimension Encoder Resolution	
▶ PLC	#4 📝 ET10 Encoder#2 👻 MPG wheel 👻 X 💌 100 📥	
G-codes settings DXF import settings	#5 📝 ET10 Encoder#4 👻 MPG wheel 💌 X 💌 100 🚖	
Macro List	#6 🕱 ET10 Encoder#0 👻 MPG wheel 💌 X 💌 100 🚖	
Macro Wizard Probing Wizard	#7 🔀 ET10 Encoder#0 👻 MPG wheel 💌 X 💌 100 🚖	
Preferences Screen		
Work Offsets		
Parking Coordinates Technology 		
Camera		
 Panel/Pendant 		
Hardware Advanced		

There are 2 encoders attached on Inputs #0,1,2,3 and set up in the dialog.

- Encoder #2 is attached to inputs #0 and #1 and used as a Pendant MPG/Wheel.
- Encoder #3 is attached to inputs #2 and #3 and used as a general purpose encoder.

For ET7 controller, Encoders #0 and #1 are connected to the X4 connector pins 11-14 (or through the ET7-KEY keyboard) and are configured despite being disabled in the myCNC settings window.

Encoder connection setup through configuration dialog.

5/10

SYS PLC Log Config	Info Support Camera C	Config				SAVE CFG
CNC Settings Axes/Motors	Source Pa	arameter De	stination Paran	neter K KO		<u>_</u>
 Inputs/Outputs/Sensors Alarms 	Encoder 👻	1	Item 💌	cnc-gvariable-7011	0.5	×
X-Alarms	Encoder 💌	2	Item 💌	motion-overspeed	1	×
Limits Triggers/Timers MP6 through binary inputs Jog through ADC inputs I/O Expand cards mapping ADC Mapping Connections Network Motion PLC G-codes settings DXF import settings Macro List Macro Wizard Probing Wizard Proferences Screen Work Offsets Parking Coordinates Technology Camera S axes RTCP						
 Hardware Advanced 						

A general purpose encoder can be connected to one of the system variables for convenient control.

There is a configuration dialog (described further in the MyCNC Configuration Dialogs manual) which can be used to set up a connection between slow encoder values and CNC parameters.

- Source a source of connection can be an Encoder, ADC, input/output pin, PWM, a global variable or other parameters
- Source/Parameter address of the source. It can be Encoder number, input pin number, global variable address etc
- Destination destination connection
- Destination/Parameter destination address
- K destination ratio. For example, Spindle speed will be increased 100RPM every encoder clicks if "K=100".
- K0 destination shift ratio. Usually left to be at 0 (field left to be blank).

On-panel rotary encoders are mostly used to control the following values on-the-fly:

- Overspeed [%]
- THC Arc reference voltage [V] (actually cutting height)
- Spindle speed

A rotary encoder should be connected to the XML configuration Item "motion-overspeed" to control Overspeed [%]

Global variable register 7011 is used to change on-the-fly Cutting height (THC Arc reference voltage)

To change Spindle speed, the XML Item "spindle-default-speed" can be used.

Last update: 2019/11/07 mycnc:rotary_encoder_connection_and_setup http://docs.pv-automation.com/mycnc/rotary_encoder_connection_and_setup?rev=1573134045 08:40

SYS PLC Log Config	Info Support Camera Co	anfig			
CNC Settings	Source Par	ameter Destination	Parameter	к ко	-
 Inputs/Outputs/Sensors 					
Alarms	Encoder	1 Item	cnc-gvariable-	0.5	
X-Alarms	Encoder 🗾	2 Item	motion-oversp	peed 1	
Triggers/Timers					
MPG through binary inputs					
Jog through ADC inputs					
ADC Mapping					
Connections					
Network					
▶ PLC					
G-codes settings					
DXF import settings					
Macro List					
 Probing Wizard 					
Preferences					
Screen Work Offects					
Parking Coordinates					
 Technology 					
Camera					
5 axes RTCP					
Hardware					
Advanced					
					-1

A further selection of commonly used Items can be found in the Common Item List manual.

Obsolete method to establish connection through "cnc-variables.xml" configuration file.

This method was used before the dialog described above was released. Only used on the old deprecated software versions

The connection assignment can be written directly in the cnc-variables.xml configuration file. For example:

```
<value name="cnc-connection-item-002"
source="encoder:3"
dest="item:motion-overspeed" >0</value>
```

- source="encoder:3" encoder #3 defined as a source
- dest="item:motion-overspeed" motion-overspeed defined as destination

Encoder #3 connected to **motion-overspeed** variable. Overspeed (%) value will be changed by rotating the encoder.

```
<value name="cnc-connection-item-003"
source="encoder:2"
dest="item:cnc-gvariable-7012">0</value>
```

- source="encoder:2" encoder #2 defined as a source
- dest="item:cnc-gvariable-7012" Global variable for THC Arc Voltage Adjustment value is a

destination for the connection

Encoder #2 is connected to the THC Arc voltage adjustment. Adjustment Arc value will be changed to +1" or -1" on every encoder click.

Encoder connection troubleshooting

- Go to the Diagnostics page in myCNC software and check which binary input pins the encoder is attached to. To do so, monitor the binary inputs section of the Diagnostics page as you turn the encoder - the relevant input pins should blink as the encoder dial is moved. The input pins #18 and #19 are used in this example, as can be seen in the following picture:
- 2. Check that the "Slow Encoder" values are changed while you turn the encoder.
- 3. Check that the Destination item value has changed while you turn the encoder.
- 4. After the checkup has been complete, reload the program to refresh the settings to the newest configuration.





Closed-loop setup

The following window is available upon navigating to Settings > Config > Hardware > Encoders:

Rolary encoder connection and setu	Rotary	encoder	connection	and	setup
------------------------------------	--------	---------	------------	-----	-------

				_										
SYS PLC Config		art Cor	nfig											SAVE CFG
CNC Settings	Encoders	#0	#	1	#2		#3	#4	#5	#6	#7	#8		#9
 Inputs/Outputs/Sensors 	Encoder Resolution	2500	- 2	2500 🔻	2500	-	2500 👻	2500 🔻	2500 🔻	512 -	512 -	512	•	512
Network Motion	Current value	9999	9	999	9999		0	0	0	0	0	0		0
PLC	Z position	0	0		0		0	0	0	0	0	0		0
G-codes settings DXF import settings	Mul	0	\$ 0	•	0	\$	0	0 🗘	0 🗘	o 🗘	0 🗘	0		0
Macro List	/(2^Div)	1	<u>-</u> 11		1	1	1 2	1 2	1 2	1 2	1		÷	1
 Probing Wizard Preferences 	Encoder Position	0	<u> </u>		0	<u> </u>	0	0	0	0	0	0		0
▶ Screen Work Offsets	Position	0.005		0.005	0.005	_	0.005	0.005	0.005	0.005				
Parking Coordinates > Technology Camera 5 axes RTCP > Panel/Pendant + Hardware Common Hardware Settings Encoders Analogue Closed Loop Pulse-Dir Closed Loop ET2/ET4 Host Modbus > Advanced									10.005			J		
	1													Ð

The following settings are available:

• Encoder resolution for each particular encoder number.

9/10

- The current encoder value is displayed on this screen. This is the fastest way to check if the encoder is connected/working for example, turning an MPG wheel handle should immediately change the current encoder value in this field for the selected encoder.
- Z-position

2024/05/01 18:06

- Mul coefficients (multiplication value), and
- /(2^Div). These Mul and Div coefficients are used due to the fact that the controller cannot handle floating number data in calculations, therefore it is necessary to first multiply and then divide a number by certain coefficients. They are used to bring the value of the encoder in line with the pulses/unit value specified in the Axes/Motors tab. Larger numbers allow to reduce the error. For example, if the ratio between the Axes/Motors value and the encoder pulse/unit value is 3.5, then the multiplication value (Mul) can be set to 7, while Div can be set to 1 ($2^{1} = 2$, 7/2 = 3.5).
- Encoder position
- Position
- Linear encoder dimension. This should be set to the proper encoder dimension to convert the impulses from a linear encoder to mm (the most common values for this setting are 1 and 5 micrometers, as shown in the screenshot).

The following global variables deal with encoder values:

9000	 (+16) Registers represent Encoder values. Writing to this registers does not affect anything. Selected channel Current Encoder value will be returned when reading these registers. Reading these registers from the controller Hardware PLC will return actual Encoder value. Encoder values in the software are updated about every 128ms. This delay should be counted when using Encoder values from the Software PLC. 9000 - Encoder #0 value 9001 - Encoder #1 value 9002 - Encoder #2 value 9003 - Encoder #3 value 9004 - Encoder #4 value 9005 - Encoder #6 value 9007 - Encoder #7 value
9200	+16. Reserved to display the encoder position on an infinite scale (no value turnover on every full encoder turn, instead the value will keep climbing indefinitely into the positives/negatives depending on where the encoder handle is spun)
9216	+16. Reserved to display the encoder position on an infinite scale WITH the current encoder dimension (to indicate the current encoder position)

These global variables allow to display encoder values on the main screen of myCNC profiles that are geared towards encoder setups (such as 1366M4E and 1366PE):



From: http://docs.pv-automation.com/ - myCNC Online Documentation	
Permanent link: http://docs.pv-automation.com/mycnc/rotary_encoder_connection_and_setup?rev=1573134045	
Last update: 2019/11/07 08:40	回来老兵思;

